

2-2006

# Collapse of the Quebec Bridge, 1907

Cynthia Pearson  
*Cleveland State University*

Norbert Delatte  
*Cleveland State University, n.delatte@csuohio.edu*

Follow this and additional works at: [https://engagedscholarship.csuohio.edu/encee\\_facpub](https://engagedscholarship.csuohio.edu/encee_facpub)

 Part of the [Civil Engineering Commons](#), and the [Structural Engineering Commons](#)

**How does access to this work benefit you? Let us know!**

*Publisher's Statement*

© ASCE

---

## Original Citation

Pearson, C., and Delatte, N. (2006). "Collapse of the Quebec Bridge, 1907." *J.Perform.Constr.Facil.*, 20(1), 84-91.

This Article is brought to you for free and open access by the Civil and Environmental Engineering at EngagedScholarship@CSU. It has been accepted for inclusion in Civil and Environmental Engineering Faculty Publications by an authorized administrator of EngagedScholarship@CSU. For more information, please contact [library.es@csuohio.edu](mailto:library.es@csuohio.edu).

# Collapse of the Quebec Bridge, 1907

Cynthia Pearson<sup>1</sup> and Norbert Delatte, M.ASCE<sup>2</sup>

---

**Abstract:** In the late 19th century, the transportation needs of Quebec led to proposals for bridging the St. Lawrence River. The Quebec Bridge was the longest cantilever structure attempted until that time. In its final design, the clear span was 548.6 m (1,800 ft) long. The bridge project was financially troubled from the beginning. This caused many setbacks in the design and construction. Construction finally began in October 1900. In August 1907, the bridge collapsed suddenly. Seventy five workers were killed in the accident, and there were only 11 survivors from the workers on the span. A distinguished panel was assembled to investigate the disaster. The panel's report found that the main cause of the bridge's failure was improper design of the latticing on the compression chords. The collapse was initiated by the buckling failure of Chord A9L, on the anchor arm near the pier, immediately followed by Chord A9R. Theodore Cooper had been the consulting engineer for the Quebec Bridge project, and most of the blame for the disaster fell on his shoulders. He mandated unusually high allowable stresses, and failed to require recalculation of the bridge dead load when the span was lengthened.

**CE Database subject headings:** Collapse; Bridge failures; Canada; St. Lawrence River; Failure investigations.

---

## Introduction

The Quebec Bridge was 20 years in the making, from the founding of the Quebec Bridge Company in 1887 to the bridge's collapse in 1907. A cantilever bridge was proposed as the most feasible design to bridge the harsh, icy waters of the St. Lawrence River. The bridge collapsed during construction on August 29, 1907, killing 75 workers. Only 11 of the workers on the span were recovered alive. Some bodies were never found. A second attempt to bridge the St. Lawrence River was made. However, it also suffered a partial collapse when the middle span fell into the river. Thirteen workers were lost in the second collapse. The bridge was finally completed in 1917, and stands today. A recent review of the history of the bridge and the two collapses was written by Middleton (2001).

## Conception, Design, and Construction

The St. Lawrence River was the main channel of trade for Quebec during the summer. During the winter, it filled with ice, and trade was completely cut off until the river iced over and travel was possible again across a dangerous ice bridge. The desire to bridge the St. Lawrence River was fueled by Quebec's need to be com-

petitive in trade. Montreal already had the Grand Trunk railway system, which passes through it from the west connecting it to Toronto. Quebec was left even farther behind when Montreal began construction in 1854 of the Victoria Bridge, which was completed in 1859, connecting it to western ports. This development quickly established Montreal as Canada's leading eastern port. Although the need was great, the job of bridging the St. Lawrence would prove to be no easy task (Middleton 2001, pp. 7–8).

The St. Lawrence River was approximately 3.2 km (2 mi) wide at its narrowest section. Its waters were about 58 m (190 ft) deep at its middle. The velocity of the river reached 13 or 14 km/h (8 or 9 mi/h) at times, and the tides ranged as high as 5 m (18 ft). During the winter, ice became stuck in the narrowest part of the channel and piled up as high as 15 m (50 ft) (Middleton 2001, p. 3).

Interest in building the Quebec Bridge arose as early as 1850. However, the project did not gather momentum until 1887, when a group of businessmen and political leaders came together and formed the Quebec Bridge Committee. Due to the high level of interest in the project, the Canadian Parliament passed an act, which incorporated the committee into the Quebec Bridge Company, with \$1 million capital and the power to issue bonds (Middleton 2001, p. 27).

The company now faced the problem of financing the great bridge. Government funding was requested. However, no money could be awarded for the project until the bridge site was selected. With some financial help from the local Quebec legislature, preliminary surveys were made. In 1898, after years of debate, the Chaudiere site was selected from the three recommended sites to be the location of the Quebec Bridge. With a site selected, bridge design proposals poured in (Middleton 2001, p. 26).

On June 16, 1897, the chief engineer of the Quebec Bridge Company wrote to a friend, who was also the president of the Phoenix Bridge Company (Holgate et al. 1908). In response, the Phoenix Bridge Company sent its chief engineer to meet with the Quebec Bridge Company's chief engineer at an ASCE meeting in Quebec in 1897. The Phoenix Bridge Company offered to prepare

---

<sup>1</sup>Graduate Student, Dept. of Civil and Environmental Engineering, Stilwell Hall SH 108, Cleveland State Univ., 2121 Euclid Ave., Cleveland, OH 44115-2214.

<sup>2</sup>Associate Professor, Dept. of Civil and Environmental Engineering, Stilwell Hall SH 108, 2121 Euclid Ave., Cleveland State Univ., Cleveland, OH 44115-2214 (corresponding author).

**Table 1.** Key Individuals in Design and Construction of Quebec Bridge

Name	Title
A. B. Milliken	Bridge superintendent of erection for 1st year of work
Benjamin A. Yenser <sup>a</sup>	General foreman of erection for remainder of project. Worked for Phoenix Bridge Company
Arthur H. Birks <sup>a</sup>	Resident engineer of erection
Collingwood Schreiber	Chief engineer for railways and canals
David Reeves	President of the Phoenix Bridge Company
Edward Hoare	Chief engineer for Quebec Bridge Company
E. R. Kinloch	Bridge erection inspector
John Sterling Deans	Chief engineer for Phoenix Bridge Company
Norman McLure	Bridge inspector, civil engineering graduate from Princeton, hired by Cooper
Peter L. Szlapka	Chief designing engineer for Phoenix Bridge Company
Robert C. Douglas	Bridge engineer for railways and canals
Simon-Napoleon Parent	President of the Quebec Bridge Company
C. C. Schneider	Commissioned to review design work on the bridge after the collapse
Theodore Cooper	Consulting engineer

<sup>a</sup>Died in the collapse.

plans for the bridge free of charge. In return, the Quebec Bridge Company would then be obligated to give the tender for construction of the bridge to the Phoenix Bridge Company. Theodore Cooper, who learned of the Quebec Bridge project at the ASCE meeting, offered his consulting services to the Quebec Bridge Company (Middleton 2001, pp. 32–33). Some of the key players in the construction and failure of the bridge are listed in Table 1.

The chief engineer of the Quebec Bridge Company, Edward Hoare, had never before worked on a bridge longer than about 90 m (300 ft). The company decided to hire a consulting engineer, and Theodore Cooper was selected from a list of six prominent engineers for the project (Holgate et al. 1908, p. 36.; Middleton 2001). Theodore Cooper was an independent consultant operating out of New York City. He was one of the foremost American bridge builders of his day. To Theodore Cooper, this project would be the crowning achievement to his life's work.


Petroski (1995) notes Cooper's strong qualifications for this project. In his long career, he had written an award-winning paper pioneering the use of steel for railway bridges, and had prepared general specifications for iron and steel bridges. His method of accounting for railroad loads on bridge structures became widely used (Middleton 2001, p. 37).

Tenders were called for on September 6, 1898 and received until March 1, 1899 (Holgate et al. 1908). They were then

reviewed by Cooper. The specifications called for a cantilever structure. The basic configuration of a cantilever bridge is shown in Fig. 1. However, suspension bridge designs were allowed, providing they came with their own set of specifications. Earlier, noted French engineer Gustave Eiffel had considered the problem and found that a cantilever design would be superior to either a suspension or an arch bridge for the Quebec site (Middleton 2001, pp. 29–30).

The concept of the cantilever structure was first used in 1867. William Middleton gives a clear definition of a cantilever bridge in his book: "cantilever bridge: a bridge form based upon the cantilever principal. In its typical form cantilever arms projecting toward the center of the span from main piers are continuous with and counterbalanced by anchor arms extending between the main piers and anchor pier at each end. A simple span suspended between the two cantilever arms completes the structure. The weight of the suspended span and the cantilever arms is counterbalanced by that of the anchor arms and an anchorage embedded in the anchor pier." (Middleton 2001, p. 175).

Six tenders were submitted for the superstructure, and two for the substructure. After review, Theodore Cooper stated, "I hereby conclude and report that the cantilever superstructure plan of the Phoenix Bridge Company is the 'best and cheapest' plan and

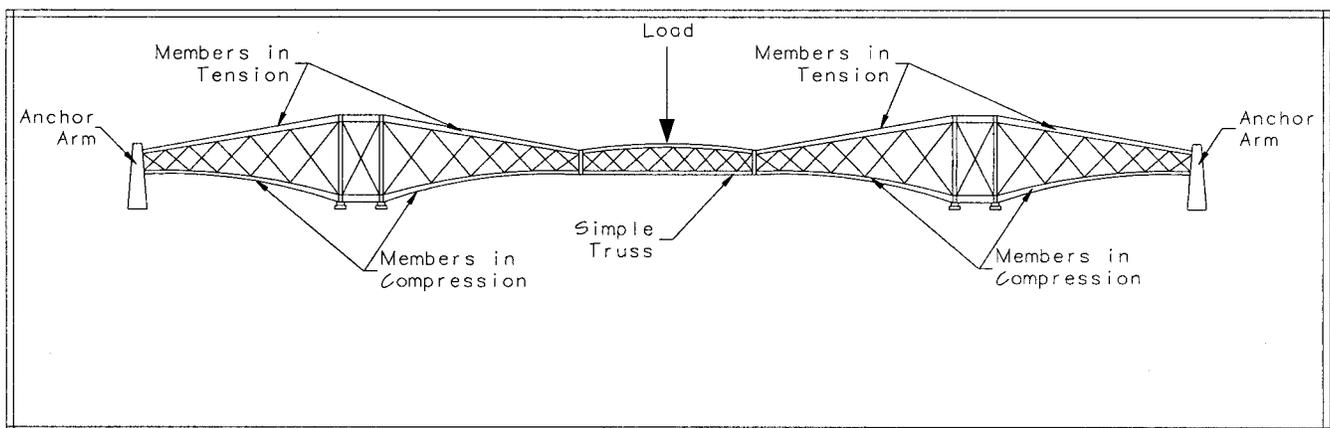**Fig. 1.** Structural behavior of cantilever bridge



**Fig. 2.** Quebec Bridge just before collapse (Modjeski et al. 1919 used by permission of Library and Archives Canada, PA 029229)

proposal submitted to me for examination and report.” (Holgate et al. 1908, p. 15., Middleton 2001, p. 34).

The Phoenix Company had been in correspondence with Cooper throughout this process (Holgate et al. 1908). In addition, the Quebec Bridge Company was in favor of the Phoenix Bridge Company to win the tender (Tarkov 1986). This provides at least an impression that the process was not fair and open, even though Holgate et al. (1908) concluded “As to either party influencing Mr. Cooper or causing him to modify his ideas so as to favour any tender, such a suggestion is, in our opinion, quite out of the question, and we believe that Mr. Cooper made his decisions and gave his opinions with absolute honesty” (Holgate et al. 1908, p. 15).

Two months later the company awarded contracts to the Phoenix Bridge Company for construction of the superstructure and to the Davis Firm for construction of the substructure. However, the Phoenix Bridge Company refused to sign a contract with the Quebec Bridge Company due to the financial provisions, which left the bridge company open to considerable risk. Financial matters were finally resolved in 1903, when additional funds became available from a government grant. On June 19, 1903, a final contract was entered into between the two companies, and the name of the Quebec Bridge Company was changed to the Quebec Bridge and Railway Company (Middleton 2001, pp. 45–47).

The Quebec Bridge was the longest cantilever structure ever to be attempted during its day. It would bridge the St. Lawrence River approximately 14 km (9 mi) North of Quebec connecting into the Grand Trunk rail line. The cantilever arms would reach a distance of 171.5 m (562.5 ft). They were to support a suspended span with a length of 205.7 m (675 ft). It would stand 45.7 m (150 ft) above the river. The initial design clear span length was 487.7 m (1,600 ft).

However, in May 1900, this span was increased to 548.6 m (1,800 ft) by Theodore Cooper. He stated that this would eliminate the uncertainty of constructing piers in such deep water, lessen the effects of ice, and shorten the time of construction of the piers. Although there were sound engineering reasons for this change, it was also true that the lengthening of the span would also make Cooper the Chief Engineer for the longest cantilever bridge in the world (Petroski 1995, p. 46; Middleton 2001).

Construction of the bridge officially began on October 2, 1900, after a grand ceremony. The Quebec Bridge Company had enough funds to begin erecting the substructure. The completed piers would stand approximately 8 m (26.5 ft) above the highest water

**Table 2.** Bridge Member Deflections

Date of observation	Member	Amount of deflection	
		(mm)	(in.)
June 15	—	1.5–6.5	1/16 to 1/4
June	A3R and A4R	1.5–6.5	1/16 to 1/4
June	A7R and A8R	1.5–6.5	1/16 to 1/4
June	A8R and A9R	1.5–6.5	1/16 to 1/4
June	A8L and A9L	19	3/4
August 6	7L and 8L	19	3/4
August	8L and 9L	8	5/16
August 20	8R	Bent	Bent
August	9R and 10R	—	—
August 23	5R and 6R	13	1/2
August 27	A9L	57	2 1/4

level. The piers were made of huge granite facing stones with concrete backing. The top 5.8 m (19 ft) of each pier was made of solid granite. The piers were tapered 1 in 12 (1 in./ft) until they reached the dimensions of 9.1 m (30 ft) by 40.5 m (133 ft) at the top. Each pier rested on a concrete filled caisson that was 14.9 m (49 ft) wide, 7.6 m (25 ft) high, and 45.7 m (150 ft) long, weighing 16.2 MN (1,600 t) (Middleton 2001, pp. 48–50).

Due to the unprecedented size of this structure, innovative construction methods proved necessary. These were well documented in frequent reports, with extensive illustrations, in the *Engineering Record* (ENR 1907a,b,c,d,e).

Under a separate contract with the Quebec Bridge Company, the Phoenix Bridge Company began the construction of the approach spans in 1902 and completed them in 1903. Erection of the superstructure portion of the bridge did not begin until July 22, 1905. The Phoenix Bridge Company agreed to have the structure completed by the last day of the year in 1908. Otherwise, the company would pay \$5,000/month after this deadline to the Quebec Bridge Company until the project was finished (Holgate et al. 1908, Middleton 2001).

## Events Leading up to Collapse

As the bridge was erected, workers and supervisors found noticeable midpoint deflections in some of the chords. When the workers tried to rivet the joints between these chords, the predrilled holes did not line up. In addition, bends (deflections) were observed in some of the most heavily loaded compression members. Over time, some of the member deflections increased.

The last photograph taken of the bridge before the collapse is shown in Fig. 2. The panels were numbered from 1, at the outer ends of the cantilever arms, through 10, at the piers. The anchor arm panels added the notation “A.” The A9L notation, therefore, refers to the chord located in the anchor arm, within the ninth panel, and on the left or west side of the bridge. Some of the major chords with their corresponding deflections, with the dates of measurement, are presented in Table 2.

Deflections were first noticed as early as mid-June, and were reported to Cooper by his on-site inspector, Norman McLure. Compression members had been cambered, so that under load the joints would line up and could be riveted together. However, some of the joints failed to close. Both men presumed that the relatively small deflections had occurred due to some unknown

preexisting condition. They were not alarmed (Middleton 2001, p. 72).

Subsequent inspections turned up more deflecting chords in August. Again, these were reported to Cooper on the same day that they were discovered. Cooper wired a message back referring to chords 7L and 8L, asking, "How did bend occur in both chords?" The chief engineer of the Phoenix Company replied to Cooper saying that he did not know (Middleton 2001, pp. 72–73).

The chief design engineer for the Phoenix Company, Peter Szlapka, was certain that the bend was put in the chord ribs at the shop. He later admitted that he never actually saw the chords in question. However, Norman McLure wrote, "One thing I am reasonably sure of, and that is that the bend has occurred since the chord has been under stress, and was not present when the chords were placed." While this dispute of how the bend occurred in chords 7L and 8L was going on, McLure reported to Cooper another similar bend in chords 8L and 9L (Middleton 2001, pp. 73–74). The members with these deflections were the lower chords of the truss on either side of the pier—the members with the highest compressive loads under the negative moment across the pier.

A disturbing pattern was emerging. The members under the highest compressive loads were gradually buckling. These were built up with laticing, and as they deflected higher stresses were placed on the laticing as well as the rivets attaching the lattices to the main compression members.

Being dissatisfied with the theories offered by the engineers on site, Cooper developed his own theory. "None of the explanations for the bent chord stand the test of logic. I have evolved another theory, which is a possible if not the probable one. These chords have been hit by those suspended beams used during the erection, while they were being put in place or taken down. Examine if you cannot find evidence of the blow, and make inquiries of the men in charge." McLure did as he was instructed, and reported back to Cooper that there was no evidence of such an incident (Middleton 2001, p. 74).

Some of the engineers were unconcerned about the problem, believing that it was nothing serious. Others were still insisting that the bends were the result of a preexisting condition. The manufacturer guaranteed that all the members had been perfectly straight when they left the yard. Another incident had occurred during the 1905 construction season, when chord A9L was dropped and bent while being handled in the storage yard. It was repaired and placed into the structure. Although at the time the repair was thought to be satisfactory, this member was later found to be the triggering cause of the collapse.

Cooper, although the most experienced, seemed to be the most confused by the problem. He was 60 years old at the time he accepted the position of consulting engineer for the Quebec Bridge project. He also accepted the responsibility of shop inspector of the steel fabrication and erection. His health was poor and because of this, he never visited the site once construction began on the superstructure. His consulting services were based on the information that was reported to him by others in charge. Cooper's official eyes and ears on the construction site was Norman McLure, a young civil engineer who had been appointed by Cooper himself. Cooper was also very poorly compensated for his work (Petroski 1995; Middleton 2001).

McLure continued to argue that the bends in the members had occurred after they were installed. Some of the workers had observed the deflecting chords and were concerned enough to not report to work for a few days. However, when McLure and Cooper disagreed on the cause of the deflections, McLure did not

have the confidence to contradict Cooper. Work continued on the bridge. There had already been a 3 day strike over working conditions, and the workers who had not agreed with the new terms had left. This greatly reduced the number of workers on the project, and there was concern that a temporary stoppage would cause more workers to leave and delay the project.

After another routine inspection, chord A9L was placed under observation when its initial deflection of 19 mm (3/4 in.) had increased to 57 mm (2 1/4 in.) in less than 2 weeks. The opposite chord A9R was bent in the same direction. There was growing concern about the deflections. One of the construction foremen decided to halt work on the bridge until matters could be resolved. On August 27, the same day construction was halted, McLure sent a message to Cooper informing him that construction would not resume until he reviewed the matter. The next day, McLure went to New York to seek advice from Cooper (Middleton 2001, pp. 78–79).


The erection foreman that had ordered the work to stop changed his mind, and with reassurance from Edward Hoare, the chief engineer of the Quebec Bridge Company, resumed work again that day. The only reason given for this decision was in a note from Hoare to Cooper stating, "the moral effect of holding up the work would be very bad on all concerned and might also stop the work for this season on account of losing the men." Two days later, news of the matter reached the Phoenixville office and the project superiors there met and discussed the problem. They relayed a message back by telephone, saying that it was safe to resume work on the bridge. They had somehow reached the conclusion that the bends in the chords had occurred before they left the yard. The Phoenix Company's chief engineer had stated that the chord members were carrying "much less than maximum load."

In the meantime, McLure was meeting with Cooper in New York. Neither of the men was aware that construction had resumed on the bridge. After a brief discussion between the two men on August 29, Cooper wired the Phoenixville office saying, "Add no more load to the bridge until after due consideration of facts. McLure will be over at five o'clock." Cooper's reasoning for informing the Phoenixville office rather than directly relaying it to the site, was that he felt that action would be taken faster if the information went to the site through Phoenixville. McLure had assured Cooper that he would wire the information to the site on his way to the Phoenixville office. In his haste to get to his destination, he neglected to send the information.


The message from Cooper reached the Phoenixville office at 1:15 p.m. It was ignored in the absence of the chief engineer. At around 3:00 p.m. Phoenixville's chief engineer returned to his office. After seeing the message, he arranged for a group meeting as soon as McLure arrived. McLure arrived at roughly 5:15 p.m. and the men discussed the circumstances briefly before deciding to wait until the next morning to decide a course of action (Middleton 2001, pp. 78–80).

## **Collapse**

Meanwhile, back at the construction site, at about the same time the decision makers in Phoenixville were ending their meeting, the Quebec Bridge collapsed at 5:30 p.m. The thunderous roar of the collapse was heard 10 km (6 m) away in Quebec (Middleton 2001, p. 80). The entire south half of the bridge, approximately 189 MN (19,000 t) of steel, fell into the waters of the St. Lawrence within 15 s. Eighty six workers were present on the

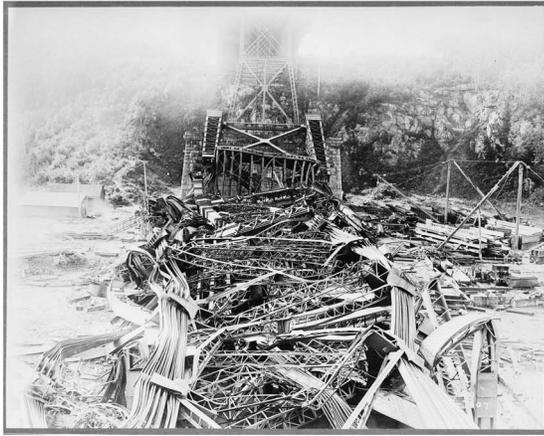

C-009766

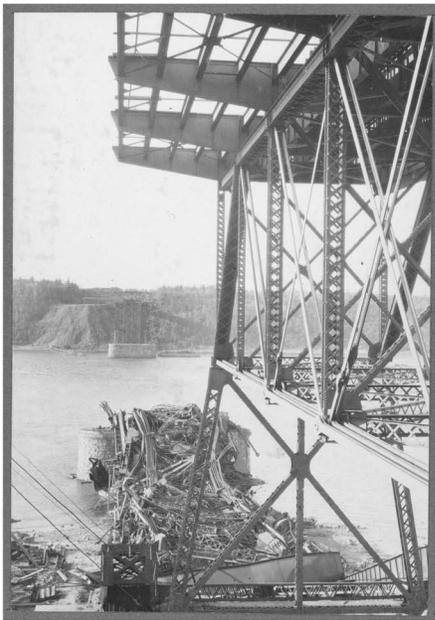

PA-020614

**Fig. 3.** Wreckage (Modjeski et al. 1919 used by permission of Library and Archives Canada, C009766 and PA020614)

bridge at the time. Only 11 workers on the span survived.

The A9L bottom compression chord, which was already bent, gave way under the increasing weight of the bridge. The load transferred to the opposite A9R chord that also buckled. The piers were the only part of the structure that survived. The wreckage is shown in Fig. 3, looking from the south bank toward the pier. Of 38 Caughnawaga Mohawk ironworkers who had left their village to work on the bridge, 33 were killed and two were injured (Middleton 2001, p. 84).

### Royal Commission Report

The Governor General of Canada formed a Royal Commission, comprised of three civil engineers, whose sole task was to investigate the cause of the collapse. They were Henry Holgate, of Montreal, John George Gale Kerry of Campbellford, Ont., and John Galbraith of Toronto. Their completed report consisted of over 200 pages plus 21 appendices. As stated by Middleton


(2001, p. 91) "...the thoroughness and objectivity of their inquiry and report stand even today as models of their kind."

The immediate cause of failure was found to be the buckling of compression chords A9L and A9R. The official report attributed the collapse to a number of reasons. Listed below are some of the major findings (Holgate et al. 1908, pp. 9–10):

1. "The collapse of the Quebec Bridge resulted from the failure of the lower chords in the anchor arm near the main pier. The failure of these chords was due to their defective design."
2. "We do not consider that the specifications for the work were satisfactory or sufficient, the unit stresses in particular being higher than any established by past practice. The specifications were accepted without protest by all interested."
3. "A grave error was made in assuming the dead load for the calculations at too low a value and not afterwards revising this assumption. This error was of sufficient magnitude to have required the condemnation of the bridge, even if the details of the lower chords had been of sufficient strength, because, if the bridge had been completed as designed, the actual stresses would have been considerably greater than those permitted by the specifications. This erroneous assumption was made by Mr. Szlapka and accepted by Mr. Cooper, and tended to hasten the disaster."
4. "The loss of life on August 29, 1907, might have been prevented by the exercise of better judgement on the part of those in responsible charge of the work for the Quebec Bridge and Railway Company and for the Phoenix Bridge Company."
5. "The failure on the part of the Quebec Bridge and Railway Company to appoint an experienced bridge engineer to the position of chief engineer was a mistake. This resulted in a loose and inefficient supervision of all parts of the work on the part of the Quebec Bridge and Railway Company."
6. "The work done by the Phoenix Bridge Company in making the detail drawings and in planning and carrying out the erection, and by the Phoenix Iron Company in fabricating the material was good, and the steel used was of good quality. The serious defects were fundamental errors in design."
7. "The professional knowledge of the present day concerning the action of steel columns under load is not sufficient to enable engineers to economically design such structures as the Quebec Bridge. A bridge of the adopted span that will unquestionably be safe can be built, but in the present state of professional knowledge a considerably larger amount of metal would have to be used than might be required if our knowledge were more exact."

### Causes of Failure

The fall of this massive bridge can be traced back to several technical factors. The top and bottom chords for the anchor and cantilever arms of a bridge were typically designed as straight members. This common practice made the fabrication of these members easier. The bottom chords for the anchor and cantilever arms in the Quebec Bridge were slightly curved, as shown in Fig. 2, for aesthetic reasons. This added difficulty to the fabrication of such unusually large members. The curvature also increased the secondary stresses on the members, reducing their buckling capacity. According to a letter written to *Engineering Record*, "As a rule secondary stresses are much more dangerous in compression than in tension members, which seem to have

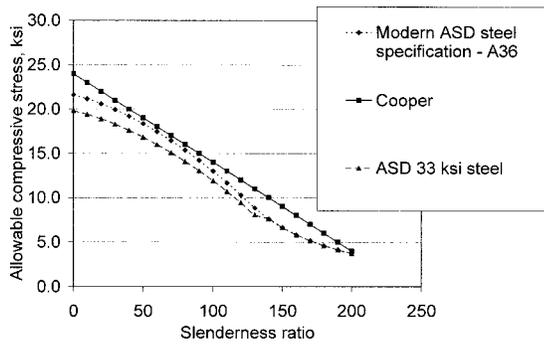

**Fig. 4.** Cooper’s allowable compressive stresses for Quebec bridge (1 ksi=6.89 Mpa)

been the first to give way in the Quebec bridge” (“The Cause of the Quebec Bridge Failure” 1907d).

Another concern during the erection of the bridge was the joints. The ends of all the chords were shaped to allow for the small deflections that were expected to occur when the chords came under their full dead load. These butt splices were bolted to allow for movement. The splices initially touched only at one end, and would not fully transfer their load until they had deflected enough for full bearing at the splices. At this point, they were to be permanently riveted in place. The result was to be a rigid joint that transferred loads uniformly across its area to ensure only axial loading. Great care had to be taken while working around these joints until they were riveted (Middleton 2001 pp. 70–72).

Adding to the design problems, Cooper increased the original allowable stresses for the bridge. He allowed 145 MPa (21 ksi) for normal loading and 165 MPa (24 ksi) under extreme loading conditions. These were questioned by the bridge engineer for the railways and canals as being unusually high. The new units stresses were accepted based solely on Cooper’s reputation (Holgate et al. 1908).

Cooper developed an allowable compressive stress formula (in psi) based on the slenderness ratio ( $l/r$ ) of the member

$$\begin{aligned} \text{allowable compressive stress} &= 165 - 0.69(l/r) \text{ MPa} \\ &= 24,000 - 100(l/r) \text{ psi} \quad (1) \end{aligned}$$

where  $l$ =length of compression member;  $r$ =radius of gyration= $\sqrt{I/A}$ ;  $I$ =moment of inertia; and  $A$ =cross-sectional area.

Cooper’s formula is compared to contemporary allowable stresses from the American Institute of Steel Construction (AISC 1989) as well as the 96.5 MPa (14 ksi) compressive allowable stress adopted for the second bridge (Middleton 2001, p. 107) in Fig. 4. AISC curves are shown for both 230 MPa (33 ksi) and 250 MPa (36 ksi) steel. Cooper’s allowable stresses are higher than those in use today by 3.3–8.7% over a range of slenderness ratios from 10 to 100. Given the lower and uncertain quality of the materials available to Cooper, along with the less developed state

of knowledge of compression members at that time and the lack of testing of compression members, Cooper’s formula represents an unsafe practice.

The Quebec Bridge was an enormous structure, and very little was known as to how it would behave mechanically. The Quebec Bridge Company lacked funding to adequately perform testing. Cooper had required extensive tests on the eyebars, which formed major tension members in the top chords. He did not require the compression members to be tested. Later, Cooper would state the reason for this as being, “There is no machine or method existing by which any such test could be made” (Middleton 2001, p. 56). However, when the company did finally secure funds for testing, Cooper rejected the idea stating that too much time had been wasted already.

Another oversight was that the stresses were not recalculated once Cooper increased the span from 487.7 m (1,600 ft) to 548.6 m (1,800 ft). The stress calculations were based on the 487.7 m (1,600 ft) span dimension. Once this error had been discovered and brought to Cooper’s attention, he immediately made an estimate of the new stresses that would occur. He found that they would be approximately 7% more. Weights were then recalculated from the new information. They were found to be as much as 10% in excess of those previously calculated (Middleton 2001, p. 65). The initial design weight for the bridge was expected to be 276 MN (62 million lb). The real weight of the bridge was estimated at 325 MN (73 million lb), an increase of 18% (Tarkov 1986).

In the rush following the final financial arrangements of 1903, the necessity of revising the assumed weights was overlooked both by the engineers of the Phoenix Bridge Company and by those of the Quebec Bridge Company, with the result that the bridge members would have been considerably overstressed after completion.

Table 3, based on the Royal Commission Report, compares the actual and assumed dead loads. “The difference between these two sets of concentrations indicate a fundamental error in the calculations for the bridge. In a properly computed bridge the assumed dead load concentrations upon which the makeup of the members is based should agree closely with the weight computed from the dimensions in the finished design and with actual weights” (Holgate et al. 1908).

At the time this error was discovered, a large portion of the fabrication had been completed and a considerable amount of bridge erection was finished. Cooper accepted these heavier loads and stresses, in addition to the already high stresses set for the bridge, as being within acceptable limits. His only other alternatives were to start over, strengthen the bridge in place, or abandon the project.

### Procedural and Professional Aspects

Cooper insisted on retaining full control of the project, even at a considerable distance. Schreiber recommended that the

**Table 3.** Comparison of Assumed and Actual Dead Load

Element	Assumed dead load		Actual dead load		Difference (%)
	(kN)	(lb)	(kN)	(lb)	
Half suspended span	21,538	4,842,000	25,328	5,694,000	17.6
Cantilever arm	58,740	13,205,200	70,300	15,804,000	19.7
Anchor arm	59,240	13,317,600	77,034	17,318,000	30.0

governmental agency of Railways and Canals hire a consultant on their behalf. This engineer would, in a sense, be double-checking Cooper's work and ultimately have the final authority. After finding this out, Cooper, the Quebec Bridge Company, and the Phoenix Bridge Company immediately objected. In a letter to Edward Hoare, Cooper wrote, "This puts me in the position of a subordinate, which I cannot accept" (Middleton 2001, p. 52). Cooper met with Schreiber personally. Following this meeting, Schreiber revised his recommendation to eliminate the need to hire an additional project consultant. The new amended order-in-council to the Railways and Canals failed to define clearly how much authority Cooper would have over the project.

According to Middleton (2001, p. 53), "While there remained a requirement to submit all plans for the approval of the chief engineer of Railways and Canals, it was treated as a perfunctory formality. When later modifications to the specifications appeared desirable, Cooper made them without reference to the government engineers, and there was no evidence that Schreiber ever questioned a decision made by Cooper or interfered in any way with the work." This opinion is supported by a statement in a letter from Deans to Cooper. In it he wrote, "The suggested action by Mr. Schreiber would place the business in a much worse condition than it was originally in." He also wrote, "...it is simply being necessary to have Schreiber's signature as a matter of form." To further these implications, in another letter from Deans to Cooper, he wrote, "I have written him again, (Schreiber) and urged him to stop entirely this proposed plan, and explaining that the sole purpose of the order in council was to give you the final authority to settle all details, the government approval being a mere formality, and in this way save time which was so valuable" (Holgate et al. 1908).

No clear chain of command existed. It was assumed that the final authority rested with Theodore Cooper. All concerns were directed toward him, even though, due to illness, he was unable to travel to the job site. There was no one present on the job site qualified to oversee this type of work or in a position to make a decision, including a decision to stop work if conditions became unsafe. Whenever the need arose, the authorities on site would confer with each other before making any decision. In the few occasions where a decision had been reached, there was hesitation in carrying it out. The authors of the Royal Commission Report wrote, "It was clear that on that day the greatest bridge in the world was being built without there being a single man within reach who by experience, knowledge, and ability was competent to deal with the crisis" (Holgate et al. 1908).

### Capacity of Compression Members

The commission had suspected that the A9L compression chord failed due to improper latticing. Compression tests were performed on one-third scale models of the compression chords in November 1907 and January 1908 to verify this theory. The compression chord members for the Quebec Bridge consisted of four multilayered ribs (Fig. 5). They were stiffened by the use of diagonal latticing to make them act as one unit. During testing, the lattice system failed explosively due to shearing of its rivets, immediately followed by buckling of the chord. This confirmed the commission's findings that the chords were inadequately designed. In Schneider's opinion, "These members consist of four separate ribs, not particularly well developed as compression members, and their connections to each other are not of sufficient strength to make them act as a unit" (Middleton 2001, p. 97).

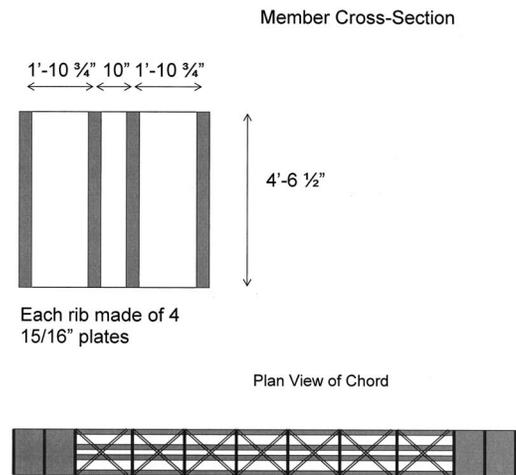


Fig. 5. Builtup compression members


Schneider wrote in his report, which was published as an appendix to the Royal Commission Report, "If a column is made up of several shapes or parts, they have to be connected in such a manner that they will act as a unit. In an ideal column each part would take its share of the load and no connection would be required. In practice, however, as stated before, bending will occur before the buckling load is reached, causing shearing strains which have to be transferred through the connections, as latticing, tie plates, or cover plates. These connection parts have, therefore, to perform the same function as the web of a girder or the web system of a truss" (Holgate et al. 1908).

This unprecedented large scale testing and studying of compression members and their connections led to major advancements in the field of engineering. Bridge specifications were improved after this collapse (Shepherd and Frost 1995). Another advancement was the formation of two organizations, the American Institute for Steel Construction in 1921, and the American Association of State Highway and Transportation Officials in 1914. These organizations advanced the field of engineering by providing the means to fund research, which had become too difficult and expensive for fabricating companies to conduct on their own (Roddis 1993).

### Ethical Aspects

Several ethical concerns can be pointed out in this case. The major one is that deformations went unheeded for so long. The engineers on site argued among themselves as to the cause. Although the workers who failed to report to work because of the deformations lacked the technical expertise, they seemed to be the only ones who understood what was really happening to the bridge (Middleton 2001, p. 78). Engineers and others in charge must be open minded to the ideas of the laborers, many of which have years of experience.

Another ethical concern was Cooper's rejection of an independent engineer to check his work. His decisions were not questioned, even when they seemed to be unusual. An independent consultant may not have allowed the higher than normal design stresses. Some of the other errors such as the underestimated dead loads and the failure to recheck the weight could have been discovered before the bridge collapsed. In the end, "Cooper's engineering expertise became the sole factor that was relied upon for assuring structural integrity of the bridge" (Roddis 1993).

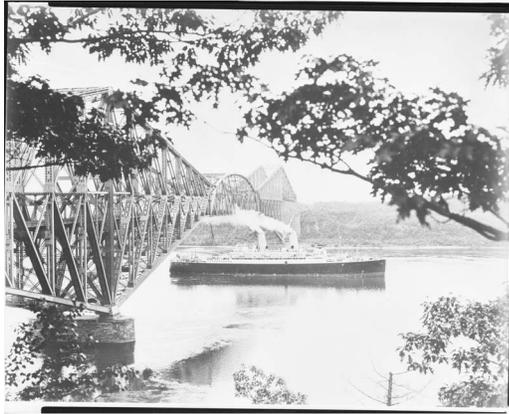

**Fig. 6.** Completed Quebec bridge (used by permission of Library and Archives Canada, PA044740)

## Aftermath

The lives of those involved with the Quebec Bridge, from the designers to the construction workers, were forever changed after the accident. None however was affected as much as the families of the ones who died and Theodore Cooper. Edward Hoare went to work for the National Transcontinental Railway Commission. John Deans continued to serve as chief engineer of the Phoenix Bridge Company. He eventually became vice president of the company. Szlapka continued his duties as chief designer for the Phoenix Company. Cooper withdrew from practice to live out a lonely retirement. He died only 2 days after the Prince of Wales officially dedicated the completed Quebec Bridge (Middleton 2001) (see Fig. 6).

## Second Bridge

After the collapse, the government took over the design and construction of the new bridge. This also provided the financial support for the project. The second bridge was substantially heavier than the first. Petroski (1995) compares dimensions of the two bridges, showing the dramatic increase in member sizes. The cross-sectional area of the critical compression member for the old bridge had been 543,000 mm<sup>2</sup> (842 in.<sup>2</sup>), whereas that of the new bridge was 1,250,000 mm<sup>2</sup> (1,941 in.<sup>2</sup>) (Petroski 1995, p. 113; Middleton 2001, p. 116).

The second attempt to bridge the St. Lawrence also encountered problems. The project suffered a second collapse in 1916, when a casting in the lifting apparatus broke, causing the center suspended span to fall into the water as it was being hoisted into place from a barge. Thirteen workers lost their lives in this accident. The 50 MN (5,000 t) span sank to the bottom of the river to rest beside the wreckage of the first bridge, which still remains there today. The second bridge was finally completed in 1917 and weighed two and a half times as much as the first one (Tarkov 1986). The construction of the second bridge was very well documented by a Report of the Government Board of Engineers, Canada Department of Railways and Canals (Modjeski et al. 1919).

## Conclusions

At Quebec, the greatest bridge in the world was under construction in 1907 under severe financial constraints, with inadequate

funds provided for either engineering work or the bridge construction itself. These constraints had delayed engineering analysis and led to adoption of unconservative specifications. When the miscalculation of the dead load was identified, the measures taken to reanalyze the structure were not adequate. On this project, virtually every conflict between safety and economy was resolved in favor of economy. Most of the poor engineering decisions were made by the prominent consulting engineer, Theodore Cooper.

Cooper's reluctance to travel to the site, based on his poor health, led to confusion about responsibility and site supervision. When skilled ironworkers observed the growing deflections, indicating a gradual collapse of the structure, a confident site supervisor might have realized the gravity of the situation and halted construction. However, the engineers on the site lacked the confidence and the authority to contradict Cooper's judgments.

The Royal Commission Report, which investigated the collapse and identified the engineering and procedural errors that had lead to it, remains a pioneering document in the field of forensic engineering. The lessons learned from the case had many important impacts on the engineering profession, particularly in Canada and the United States.

## Acknowledgment

Support for this research was provided by the National Science Foundation under the project "Developing Case Studies in Failures and Ethics for Engineering Educators," Project No. DUE 0127419.

## References

- American Institute of Steel Construction (AISC). (1989). *Manual of steel construction, allowable stress design*, 9th Ed., Chicago.
- ENR. (1907a). "The anchor pier towers of the Quebec Bridge." *Engineering Record*, 55, 34–35.
- ENR. (1907b). "Erection attachments for bottom chords and vertical posts of the Quebec Bridge." *Engineering Record, Building Record Sanitary Engineer*, 55, 77–74.
- ENR. (1907c). "Erection of the main vertical posts of Quebec Bridge." *Engineering Record*, 55, 92–94.
- ENR. (1907d). "The cause of the Quebec Bridge failure." *Engineering Record, Bridge Engineer*, 56, 276.
- ENR. (1907e). "The Quebec Bridge superstructure details, Part VIII." *Engineering Record, Building Record Sanitary Engineer*, 169–170.
- Holgate, H., Derry, J., G. G., and Galbraith, J. (1908). Royal Commission Quebec Bridge Inquiry Rep. *Sessional Paper No 154*, S.E. Dawson, printer to the King, Ottawa.
- Middleton, W. D. (2001). *Bridge at Quebec*, Indiana University Press, Ind.
- Modjeski, R., Borden, H. P., and Monsarrat, C. N. (1919). "The Quebec Bridge over the St. Lawrence River." *Rep. of the Government Board of Engineers*, Canada Department of Railways and Canals, Canada.
- Petroski, H. (1995). *Engineers of dreams: Great bridge builders and the spanning of America*, Knopf, New York.
- Roddis, W. M. K. (1993). "Structural failures and engineering ethics." *J. Struct. Eng.*, 119(5), 1539–1555.
- Shepherd, R. and Frost, J. D. (1995). *Failures in civil engineering: Structural, foundation and geoenvironmental case studies*, ASCE, New York.
- Tarkov, J. A. (1986). "A disaster in the making." *American Heritage of Invention and Technology*, Spring, 1(3) 10–17.